Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING _ HAL040008 11/05/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1328 S. E. SECOND STREET **SNOW HILL ASSISTED LIVING** SNOW HILL, NC 28580 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 000 Initial Comments C 000 This report is of a Biennial Construction Survey done by Bob Getchell on November 5, 2015. This Facility was first licensed as a Home for the Aged on November 6, 1996 for Forty (40) Resident Beds. Therefore the facility must meet the 1996 and the applicable portions of the 2005 Rules for the Licensing of Adult Care Homes, and, the 1996 North Carolina State Building Code Section 409.1 Group I Unrestrained Occupancies. Deficiencies were noted which will require a new plan of correction. C 111 C 111 Must Have Current San. & Fire Safety Reports SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION(f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: 1. Based on observation, the fire drills are not being conducted on the proper schedule. This could cause personnel to not know their responsibilities in a fire emergency. Findings include: Some fire drills are being conducted at shift change using personnel from both shifts. Each shift must have separate fire drills to specifically train personnel on that shift to evacuate residents, without guidance from personnel on other shifts. 2. Based on observation, current reports were

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE (X6) DATE

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01	(X3) DATE SURVEY COMPLETED
	HAL040008	B. WING	11/05/2015

NAME OF PROVIDER OR SUPPLIER

STREET ADDRESS, CITY, STATE, ZIP CODE

SNOW HILL ASSISTED LIVING

1328 S. E. SECOND STREET SNOW HILL. NC 28580

SNOW HILL ASSISTED LIVING SNOW HILL, NC 28580						
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE		
C 111	Continued From page 1	C 111				
	not available at the time of the survey.					
	Findings include: The following reports were not available at the time of the survey: a) Sanitation report for the building, b) Fire Marshal's Report,					
C 133	Bathrooms-Hand Grips	C 133				
	SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (e) The requirements for bathrooms and toilet rooms are: (6) Hand grips shall be installed at all commodes, tubs and showers used by or accessible to residents;					
	This Rule is not met as evidenced by: 1. Based on observation, the facility was not maintained in a safe manner by having a loose grab bar at the toilet.					
	Findings Include: The room 109 bathroom has a loose grab bar at the toilet.					
C 164	Housekeeping and Furnishings-Clean, Repaired	C 164				
	SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (1) have walls, ceilings, and floors or floor coverings kept clean and in good repair; (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing					

Division of Health Service Regulation

STATE FORM 6899 20Z821 If continuation sheet 2 of 7

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING _ HAL040008 11/05/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1328 S. E. SECOND STREET **SNOW HILL ASSISTED LIVING** SNOW HILL, NC 28580 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 164 Continued From page 2 C 164 facilities. This Rule is not met as evidenced by: 1. Based on observation, the resident furnishings in bedrooms and other areas were not maintained in good condition. Findings include: a) Room 210 has furniture with handles loose/missing on the drawers. b) Room 208 has furniture with handles loose/missing on the drawers. c) Room 203 has furniture with handles loose/missing on the drawers. d) Room 105 has furniture with handles loose/missing on the drawers. e) Room 104 has furniture with handles loose/missing on the drawers f) Room 102 has furniture with handles loose/missing on the drawers C 166 Housekeeping-Maintained Free of Hazards C 166 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND **FURNISHINGS** (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards: (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the building was not maintained in a safe manner by improper storage of oxygen cylinders. This would affect all residents by potentially exposing them to hazards from a ruptured cylinder.

Division of Health Service Regulation

STATE FORM 6899 20Z821 If continuation sheet 3 of 7

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING _ **HAL040008** 11/05/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1328 S. E. SECOND STREET **SNOW HILL ASSISTED LIVING** SNOW HILL, NC 28580 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** DATE CROSS-REFERENCED TO THE APPROPRIATE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) TAG DEFICIENCY) C 166 Continued From page 3 C 166 Findings include: The oxygen bottles are being stored in a beverage crate that can not adequately prevent them from tipping over. C 189 Building Equipment Maintained Safe, Operating C 189 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the building fire protection equipment was not maintained to keep the facility safe. This would affect all residents if the systems failed to detect smoke or suppress a fire. Findings include: a. The sample tubes for the HVAC duct mounted smoke detectors were dirty in the HVAC unit over the center section 2. Based on observation, the building mechanical equipment was not maintained to keep the facility safe. This would affect all residents if the systems failed to detect smoke or suppress a fire. Findings include:

Division of Health Service Regulation

Radiation dampers in the HVAC ceiling vents are

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING _ **HAL040008** 11/05/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1328 S. E. SECOND STREET **SNOW HILL ASSISTED LIVING** SNOW HILL, NC 28580 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 189 Continued From page 4 C 189 disabled, or have activated in the following locations: a. Soiled Linen room b) Laundry room damper has been tied open. c) Dining Room d) Pantry 3. Based on observation, the building was not maintained in a safe manner by not maintaining the fire-resistance rating of building components. This would affect all residents by not containing smoke and fire in the room or smoke compartment of origin. Findings include: a. The HVAC vent in the Laundry/water heater room is falling out of the ceiling b. The flue escutcheons on the two gas-fired water heater exhausts in the Laundry / water heater room have slid down and no longer cover openings to the attic. c) Activity Room has an unprotected penetration in the wall d) The Kitchen ceiling has unprotected penetrations by Ansul piping e) The kitchen ceiling has a sprinkler escutcheon that has a gap revealing an opening to the attic. f) Dining Room has a gypsum patch covering a hole in the ceiling. Repair and refinish g) The Nurse Station has an unprotected penetration in the ceiling. h) The corridor med room door at the Nurse station has a hole over the knob i) Room 105 bathroom has wall and ceiling joints that are separating. j) There is a hole over the door in the Care Coordinators office These unprotected openings are not in

Division of Health Service Regulation

conformance with the requirement to use a

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING _ HAL040008 11/05/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1328 S. E. SECOND STREET **SNOW HILL ASSISTED LIVING** SNOW HILL, NC 28580 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 189 Continued From page 5 C 189 through penetration fire stop system that has been tested in accordance with ASTM E-814. 4. Based on observation, the facility components were not maintained operable by having doors that did not close completely and latch. Findings include: The following doors have issues: a) Dining Room door is beoing held open with a wedae. b) Room 102 has a corridor door that will not close and latch. c) Room 101 has a bathroom door that will not close and latch, 5. Based on observation, the building plumbing equipment was not maintained in a safe manner. This would affect all residents by potentially creating a slip and fall hazard Findings include: a) There is a toilet coming loose from the floor in the room 103 bathroom 6. Based on observation, the building electrical system was not maintained to keep the facility safe. This would affect all residents by potentially exposing them to a shock hazard. Findings include: Damaged outlets were observed in the following locations: a) Laundry has a duplex outlet cover missing. b) Room 108 has a broken duplex outlet with exposed contacts, (repaired by licensed electrician while on-site),

Division of Health Service Regulation STATE FORM

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING _ HAL040008 11/05/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1328 S. E. SECOND STREET **SNOW HILL ASSISTED LIVING** SNOW HILL, NC 28580 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 199 Continued From page 6 C 199 C 199 C 199 Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the building exhaust ventilation was not maintained in accordance with this Rule. Findings include: The exhaust fans are not working in the following locations: a) Laundry b) Room 209 shared bathroom c) Bathing Room near 207 d) Room 110 shared bathroom

6899

Division of Health Service Regulation STATE FORM